



SKODA OCTAVIA

VIN	TMBAJ7NE5J0255291
Registration	B144PTK
Mileage	224,003 km
First registration date	13/03/2018
Body colour	Grey

INSPECTION DETAILS

Inspection date	08/04/2025 12:50:50
-----------------	---------------------

VEHICLE INFO

Make	Skoda	Fuel type	Diesel
Model	Octavia	Mileage	224,003 km
VIN	TMBAJ7NE5J0255291	Number of seats	5
Registration	B144PTK	Interior colour	Black
First registration date	13/03/2018	Body colour	Grey

DOCUMENTS AND MAINTENANCE

Number of keys total	1	Type of Maintenance book	Digital maintenance
Registration certificate original	Yes	User's manual	Yes



EQUIPMENT ACCORDING TO INSPECTOR

Abnormal engine noises	Yes	Head-up Display	No	Steering wheel multifunctional	Yes
Adaptive cruise control	Yes	Metallic paint	Yes	Tinted windows	Yes
Airco functioning	No	Mirrors functioning	Yes	Type of climate control	Autom climate control
All seatbelts functional, damage free	Seatbelt FL NOK / Seatbelt FR NOK	Number of charging cables (normal)	0	Type of headlighting	Headlighting Xenon
Android Auto	Yes	Number of charging cables (rapid charge)	0	Type of Lining	Lining fabrics
Apple CarPlay	Yes	Power steering functioning	Yes	Type of Tow bar	No Tow bar
Cruise Control	Yes	Radio multimedia	Yes	Vehicle running	No
First aid kit	Yes	Rear parking sensors	Yes	Windows electric F	Yes
Functioning headlight L	No	Seats F heated	Yes	Windows electric functioning	Yes
Functioning headlight R	No	Spare wheel	No	Windows electric R	Yes

TIRES



Position	Tread	Manufacturer	Dimensions	Tire season	Type of rims	Runflat
Front Left	1.0 mm	Michelin	205/55 R 16 91 W	Winter	Aluminium	No
Front Right	1.0 mm	Michelin	205/55 R 16 91 W	Winter	Aluminium	No
Rear Left	5.0 mm	Other	205/55 R 16 91 H	Winter	Aluminium	No
Rear Right	5.0 mm	Other	205/55 R 16 91 H	Winter	Aluminium	No

EXTERIOR DAMAGES

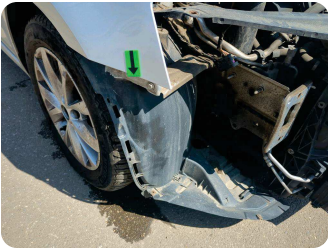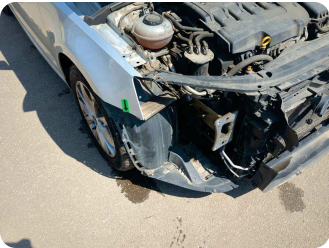

17 | BUMPER F

Type	Missing
Repair mode	Replace and paint

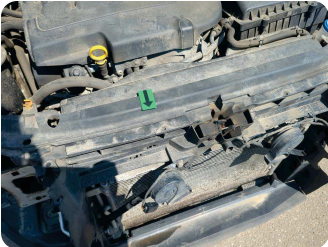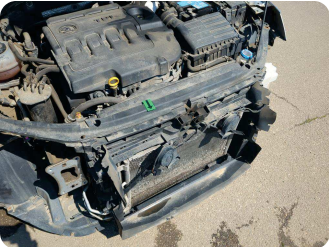


18 | GRILLE

Type	Missing
Repair mode	Replace





19 | GRILLE

Type	Missing
Repair mode	Replace

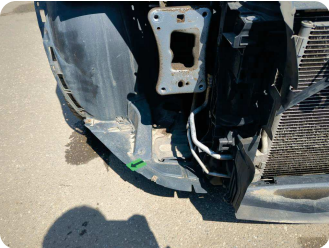



20 | FOG LAMP R

Type	Missing
Repair mode	Replace

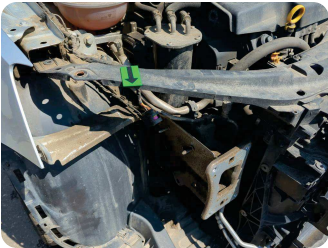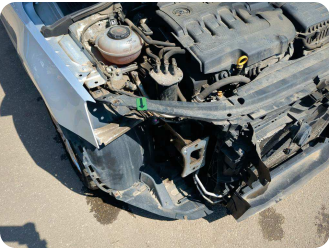



21 | XENON HEADLIGHT R

Type	Missing
Repair mode	Replace

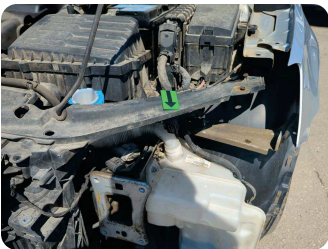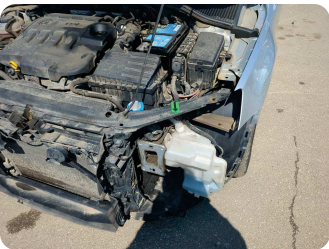



22 | XENON HEADLIGHT L

Type	Missing
Repair mode	Replace

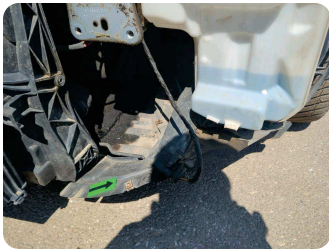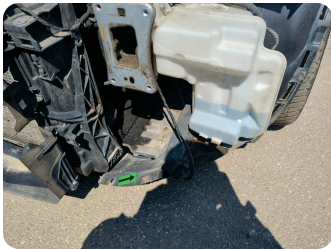

23 | FOG LAMP L

Type	Missing
Repair mode	Replace

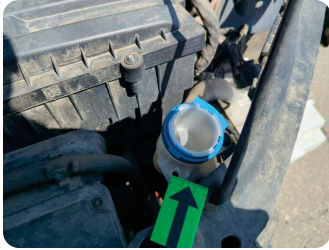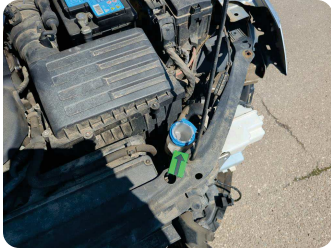

24 | SHUTTER / COVER F



Type	Missing
Repair mode	Replace

Comments: Dauna se referă la capacul bidounului lichid parbriz.





25 | BONNET

Type	Dent(s) and scratch(es)
Repair mode	Replace and paint

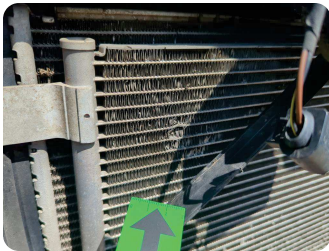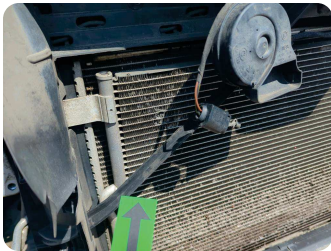


26 | RADAR

Type	Damaged
Repair mode	Replace

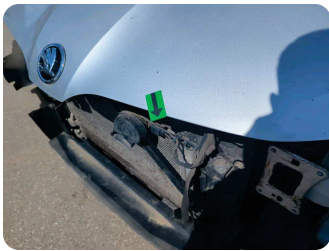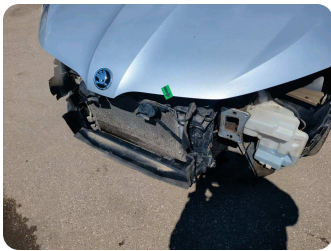

27 | GRILLE FRAME

Type	Missing
Repair mode	Replace

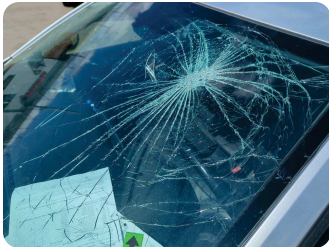

28 | WINDSCREEN

Type	Crack
Repair mode	Replace