



VEHICLE APPRAISAL REPORT

VEHICLE DETAILS

Vin Number	6FPPXXMJ2PLL34557	Plate	B162MTS	Odometer	75896
Make	FORD	Model	Ranger	Body Type/Doors	estate/4
Registration Date	10/03/2021	Interior Colour	Black	Exterior Colour	Grey
Smog Certificate Date	07/03/2024	Maintenance Odometer 0		Maintenance Date	07/03/2024
Gears	6	Gear Type	Automată	Seats	5
Fuel Type	Diesel	Drive	Tracțiune integrală selectabilă	HP	214 / 157

INSPECTION DETAILS

Inspection Date	07/03/2024 14:02:21	Inspection Location	TRITON INTERNATIONAL CARGO SRL
-----------------	---------------------	---------------------	-----------------------------------



DOCUMENT LIST

Audio Manual	✓	Delivery Condition Report	✗
Emmissions Cert	✗	Euro Sticker	✗
Insurance	✗	Original Key	✓
Owners Manual	✓	Registration Form	✗
Service Manual	✓	Spare Key	✗
Tax Sticker	✗	Transport Licence	✗

ACCESSORIES

6 Airbag	✓	ABS	✓
AC - Working: YES	✓	Air Condition Automatic	✓
All Wheel Drive (4 X 4)	✓	Alloy wheels	✓
Antenă	✓	Audio CD Player	✓
Central Arm Rest	✓	Central Locking System	✓
Emergency Kit	✓	Fire Extinguisher	✓
Fog Lights	✓	Heated Seats	✓
Leather Upholstery	✓	Multifunctional Steering Wheel	✓
Navigation System	✓	Oil Level: Max	✓
On-board Computer	✓	Original Key	✓
Outside Mirror Power	✓	Power Steering	✓
Power Windows	✓	Ram	✓
Spare Wheel	✓	Steering Wheel Leather	✓
Steering Wheel Multifunction	✓	Tail Board	✓
Transmission Auto	✓	Warning Triangle	✓
Windshield Glass Heated	✓		

REMOVABLE ITEMS

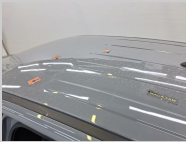
Tail Board	✓
------------	---

TYRES

Position	Tread	Manufacturer	Diameter	Actual Size	Tyre Season
Spare	7 mm	B.F. Goodrich	17	285/70	Summer
Front Left	6 mm	B.F. Goodrich	17	285/70	Winter
Front Right	6 mm	B.F. Goodrich	17	285/70	Winter
Rear Left	6 mm	B.F. Goodrich	17	285/70	Winter
Rear Right	6 mm	B.F. Goodrich	17	285/70	Winter

EXCEPTION / DAMAGE

1		Part	Door - Left Front	2		Part	Pillar - Left Front
		Type	Multiple Dents			Type	Multiple Dents
		Severity	6 cm - 8 cm			Severity	4 cm - 6 cm
		Repair Mode	Repair Metal / Refinish			Repair Mode	Repair Metal / Refinish
		Cause	In Service			Cause	In Service
3		Part	Hood / Bonnet - Front	4		Part	Pillar - Right Front
		Type	Multiple Dents			Type	Multiple Dents
		Severity	Over 30 cm			Severity	6 cm - 8 cm
		Repair Mode	Repair Metal / Refinish			Repair Mode	Repair Metal / Refinish
		Cause	In Service			Cause	In Service
5		Part	Door - Right Front	6		Part	Door Glass - Right Front
		Type	Multiple Dents			Type	Moulding/Emblem/Strip Damage
		Severity	4 cm - 6 cm			Severity	Replace
		Repair Mode	Repair Metal / Refinish			Repair Mode	Remove & Replace
		Cause	In Service			Cause	In Service

7		Part	Door - Right Rear
		Type	Dented, No Pnt Dmg
		Severity	3 cm - 4 cm
		Repair Mode	Repair Metal / Refinish
		Cause	In Service
8		Part	Door Glass - Right Rear
		Type	Moulding/Emblem/Strip Damage
		Severity	Replace
		Repair Mode	Remove & Replace
		Cause	In Service
9		Part	Roof - Top
		Type	Multiple Dents
		Severity	Over 30 cm
		Repair Mode	Repair Metal / Refinish
		Cause	In Service

INTERIOR DAMAGES

10		Part	Seat - Right Front
		Type	Moulding/Emblem/Strip Loose
		Severity	Replace
		Repair Mode	Remove & Replace
		Cause	In Service
11		Part	Seat - Rear
		Type	Stained / Soiled
		Severity	8 cm - 10 cm
		Repair Mode	No Action
		Cause	In Service
12		Part	Parcel Shelf - Rear
		Type	Moulding/Emblem/Strip Damage
		Severity	Replace
		Repair Mode	Remove & Replace
		Cause	In Service

INSPECTION CHECKLIST

Smoker : No
Vehicle Not Driveable : No

COMMENTS

Auto prezinta urme de grindina pe mai multe elemente de caroserie.Auto murdar-posibil daune ascunse,Volan uzat,Pornire motor -da ,Funct. lumini -da ,Funct. geamuri - da ,Funct. Oglinzi - da, Servo - da, Sist. audio - da ,Martori bord aprinsi -da(adblue),Zgomot anormal motor -nu, Capac capsulare motor - da, Element insonorizare capota -da, Cutie de viteze-automata, Frane normal, Esapament - normal, Centuri de sig. -da.










StandardStandardStandardStandardStandardStandardStandardStandard










StandardStandardStandardStandardStandardRef 1 ;Ref 1 ;Ref 2 ;










Ref 2 ;Ref 3 ;Ref 3 ;Ref 4 ;Ref 4 ;Ref 5 ;Ref 5 ;Ref 6 ;










Ref 6 ;Ref 7 ;Ref 7 ;Ref 8 ;Ref 8 ;Ref 9 ;Ref 9 ;Ref 10 ;







Ref 10 ;Ref 11 ;Ref 11 ;Ref 12 ;Ref 12 ;